

November-29-12 9:49:41 AM

Page 1

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Crosstube Turning Detail

Stop . *NS2*

Start Date: 29/11/2012 **Start Qty:** 1.00

*** 1 ***

Cust Item ID:

Required Date: 13/12/2012 **Req'd Qty:** 1.00

*** 1 ***

Customer:

Reference:

Approvals: Process Plan: *MLJ*

Date: 12-11-29 Tooling:

Date:

Run Start *NR1*

QC:

Date: _____ **SPC (Y/N):** _____

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
-----------------	---------------------

D212-664-141 Rev D (DEO)

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA113

2-Turn first side as per Folio FA113

3-Blend transition lines only, ****do not sand whole tube****:

FOLIO REV: 44

DWG REV: A

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: John Date: 12/12/21QA Closed: OK Date: 11

Work Order: <u>93997</u> Part No. <u>D212-664-101TRN</u> NCR No. <u>12-2155</u>				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input checked="" type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>	12/12/11	100	1	Ultra sound wall measurement out of tolerance at one cuff.	DAS 12-89 12/12/11	Acceptable. Cuff not under bending stress	DAS 12-89 12/12/11	JW 12-12-14	DAS 1F 12/12/12																		
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input checked="" type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend. <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
--	--	---

<input type="checkbox"/> Ovalized <input checked="" type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	
---	---	--

Work Order ID 93997

November-29-12 9:49:41 AM

93997

Page 2

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120		0.00							
120	MORI SEIKI CNC LATHE LARGE								
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA113								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit. FOLIO REV: <u>14</u> DWG REV: <u>0</u>								
	3-Remove sand and plugs								
130									
130	QC1- Inspect dimensions to dimension sheet	0.00							
QC	Memo	0.00							
Quality Control	+ PERFORM ULTRA SONIC MEASUREMENT								

mm
12/12/06

mm
12/12/06

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width:100%; font-size: small;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>	12/12/14	1W	1	O.D of Cuff is 0.005" UNDER tolerance	DAS 12 28 12/12/14	Acceptable	DAS 12 28 12-12-14		
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 93997

November-29-12 9:49:41 AM

93997

Page 3

Item ID: D212-664-101TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control	+ CHECK ULTRA SONIC MEASUREMENT AND ORIENTATION FOR BENDING								
145		0.00							
145									
Crosstubes	Memo	0.00							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

JW 12-12-14

MO 12/12/17

Rm/MO 12/12/17

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 93997

November-29-12 9:49:41 AM

93997

Page 4

Item ID: D212-664-101TRN

Accept

N9000040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 29/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							
160									
QC	Memo	0.00							
Quality Control									
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	Identify and Stock in kanban rack								
	Location: <u>LG</u>								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.00							
Quality Control									

D45
9035
12-12-17

MD 12/12/17

12/12/18

12.12.18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	---	---	--	---

Picklist Print

November-29-12 9:49:46 AM

Page 1

Work Order ID: 93997

93997

Parent Item: D212-664-101TRN

D212-664-101TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 29/11/2012

Required Date: 13/12/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 removed Polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty.	Qty Issued	Date Issued	Status
D6005-128		Manufactured	No			120	Each	66.0000	1	1			
D6005-128									**				
Crosstube Material													

Location	Loc Qty	Loc Code
LG	40	
75631	40	
LG015	26	
75628	26	

1 man. 12/12/03

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		
<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		


DART AEROSPACE LTD	Work Order:	93997
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number:	D212-664-141
Inspection Dwg: D212-664-141 Rev: D		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	200	/		VERN	CNC-08
	R0.063	+/-0.010	.063	/		RL	
	2.740	+0.005/-0.000	2.741	/		VERN	CNC-08
	5.097	+/-0.030	5.160	/			
	2.304	+0.005/-0.000	2.302	/			
	2.340	+0.005/-0.000	2.342	/			
	2.398	+0.005/-0.000	2.401	/			
	2.448	+0.005/-0.000	2.451	/			
	2.498	+0.005/-0.000	2.499	/			
	2.549	+0.005/-0.000	2.552	/			
	2.599	+0.005/-0.000	2.600	/			
	2.671	+0.005/-0.000	2.671	/			
	2.701	+0.005/-0.000	2.701	/			
SIDE B	0.200	+/-0.010	200	/		VERN	CNC-08
	R0.063	+/-0.010	.063	/		RL	
	2.740	+0.005/-0.000	2.740	/		VERN	CNC-08
	5.097	+/-0.030	5.160	/			
	2.304	+0.005/-0.000	2.309	/			
	2.340	+0.005/-0.000	2.343	/			
	2.398	+0.005/-0.000	2.403	/			
	2.448	+0.005/-0.000	2.453	/			
	2.498	+0.005/-0.000	2.501	/			
	2.549	+0.005/-0.000	2.551	/			
	2.599	+0.005/-0.000	2.600	/			
	2.671	+0.005/-0.000	2.671	/			
	2.701	+0.005/-0.000	2.701	/			
	126.514	+/-0.020	126.500	/		TAPG	LC-15

DART AEROSPACE LTD	Work Order:	<u>93997</u>
Description: Crosstube Assembly (205/212/412 High Fwd)	Part Number:	D212-664-141
Inspection Dwg: D212-664-141 Rev: D		Page 2 of 2

WALL THICKNESS MEASUREMENT

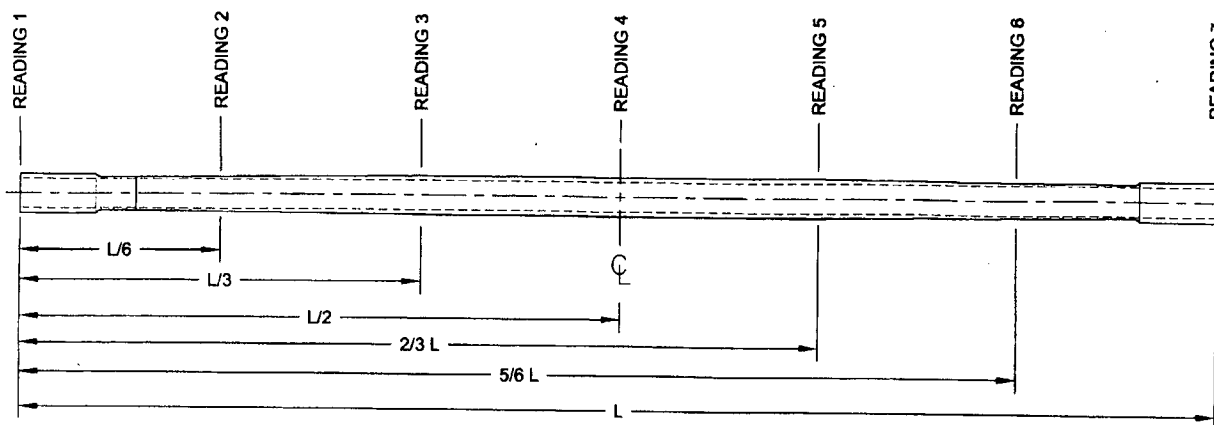

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	392	389	374	373	.019	0.048"
READING 2 L = 21.08	255	257	246	225	.032	
READING 3 L = 42.17	368	368	350	342	.026	
READING 4 L = 63.257	390	395	381	369	.026	
READING 5 L = 84.337	377	361	339	343	.038	
READING 6 L = 105.417	270	250	272	233	.048	
READING 7 L = 126.514	406	392	352	368	.054	

Calibration Result

Actual Block Thickness: 100-500

Sitiescan 250 Measured Thickness: 100-500

Measured by:	<u>mm.c</u>
Date:	<u>12/12/07</u>

Audited by:	<u>JW</u>
Date:	<u>12-12-14</u>

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-101)	KJ/JLM	
B	06.03.15	Tolerance revised for 5.097 per Dwg Rev update	KJ/JLM	
C	07.05.28	Dwg Rev updated	KJ/JLM	
D	10.02.02	Dimension 126.514 was 126.51	KJ	
E	12.06.04	Wall thickness form added	KJ	<u>[Signature]</u>

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

UNCLASSIFIED
SUBJECT: DART
W/OUT
V. 0.000000
NO 93997 MJS
12-11-29


REMOVED FROM UNDER REVIEW PER
ECN # 11-604
4 11.15
FOR PRO-SEALING SUPPORT
21.07.26

DEO ATTACHED

RELEASED
2009-10-29
MM

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

93997

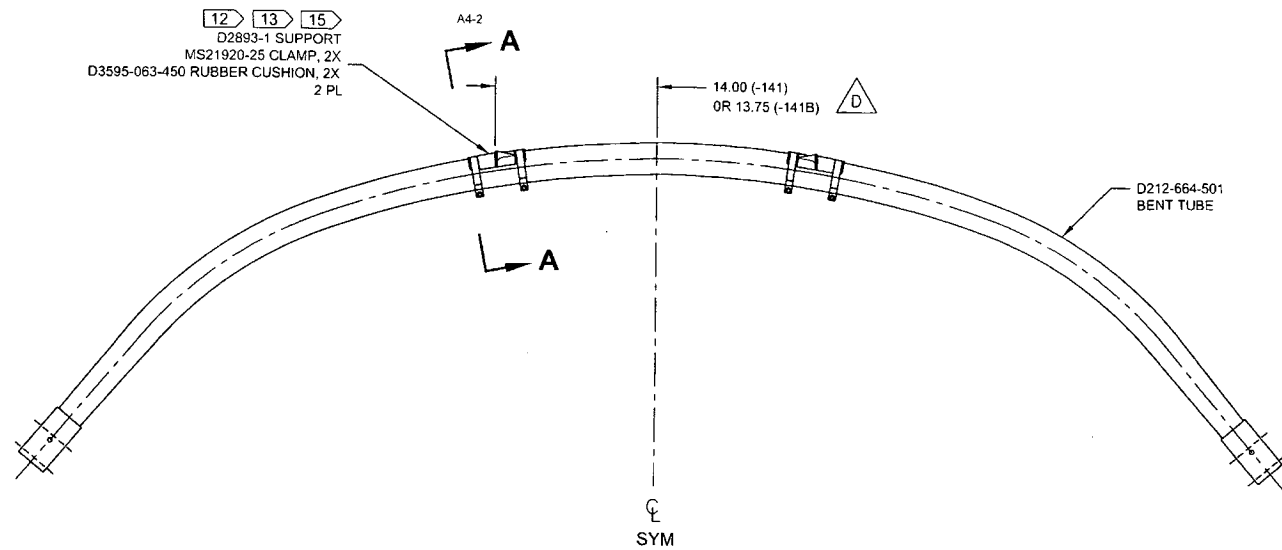


**D212-664-141/-141B
ASSEMBLY DETAIL**

DCW#11-614
1.07.26
UNDER REVIEW
4.11.13

DEO ATTACHED


RELEASED
2009-10-29

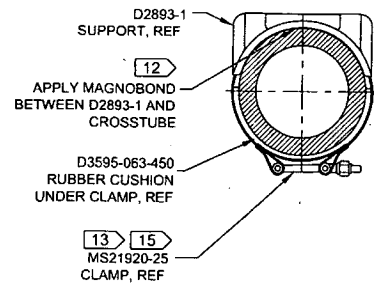

SECTION A-A D5-2
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	D	D212-664-141	SHEET 2 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	H	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

93997

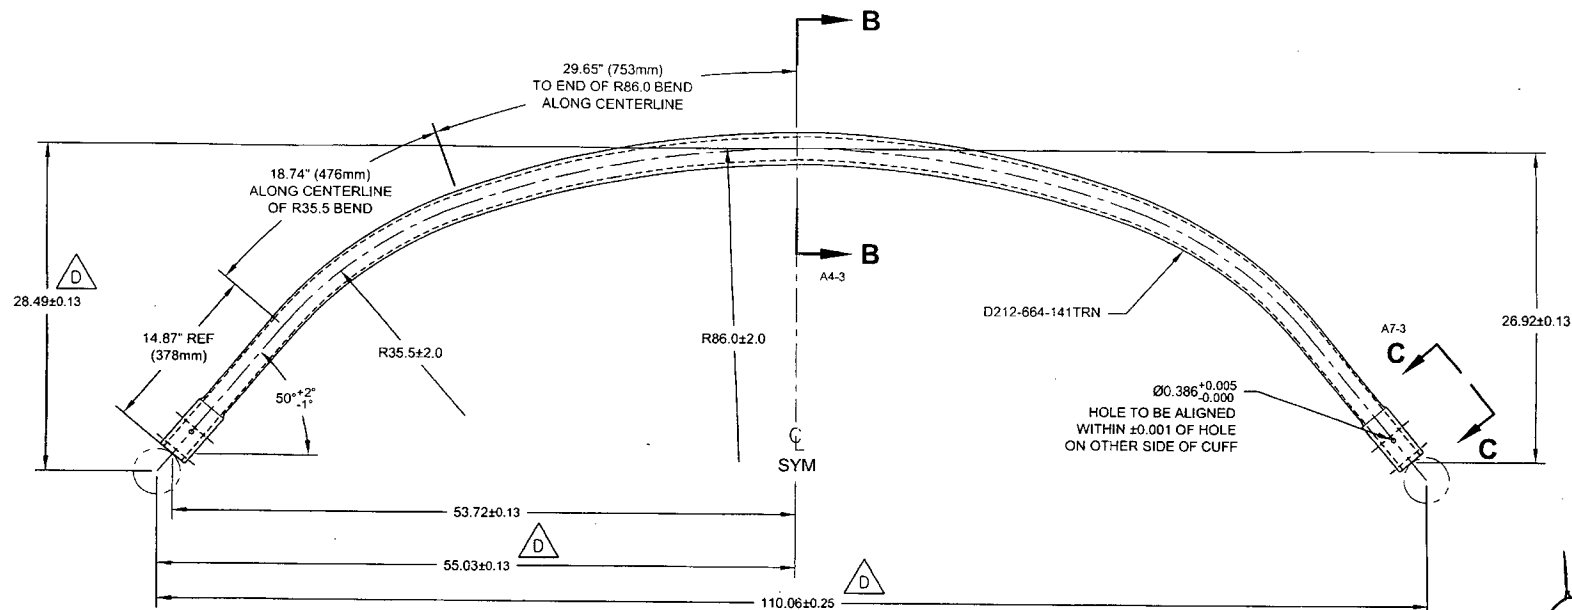

D212-664-501
BENDING AND DRILLING DETAIL




UNDER REVIEW


11.09.03

DEO ATTACHED

RELEASED
2009-10-29

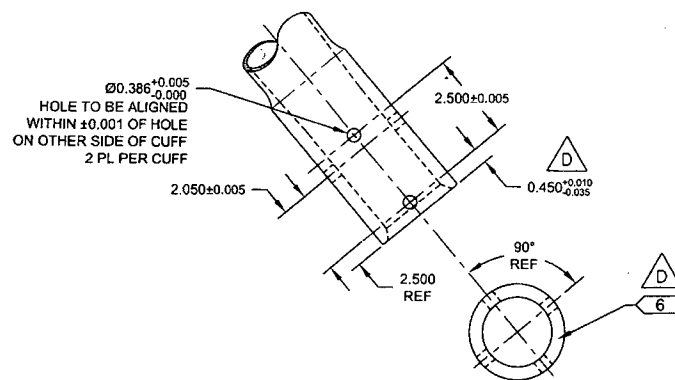


VIEW C-C: CUFF DETAIL
SCALE 3X

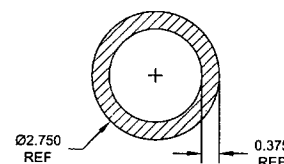

SECTION B-B
SCALE 4X



DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	JP	DRAWING NO.	REV. D
MFG. APPR.	JP	D212-664-141	SHEET 3 OF 4
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

93997

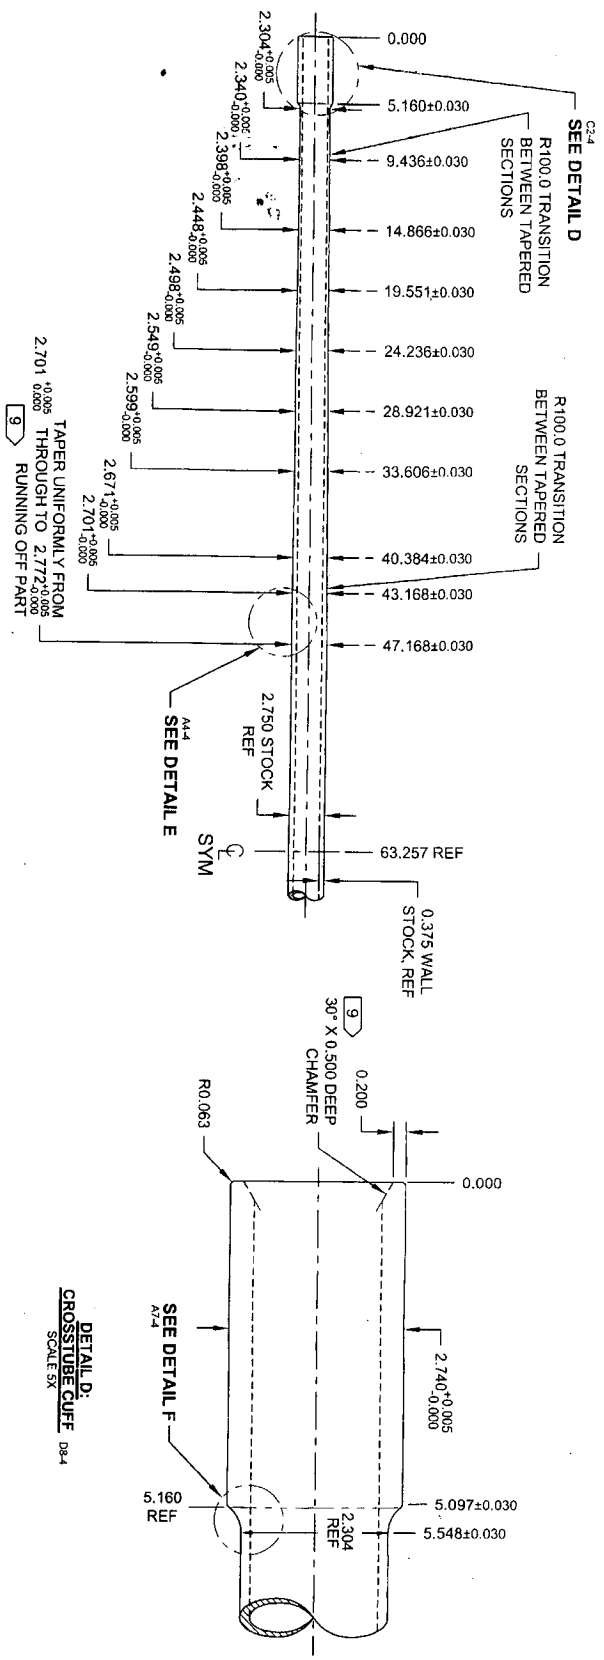

DETAIL D:
CROSS-TUBE CUFF
SCALE 5X

D212-664-141TRN
TURNING DETAIL

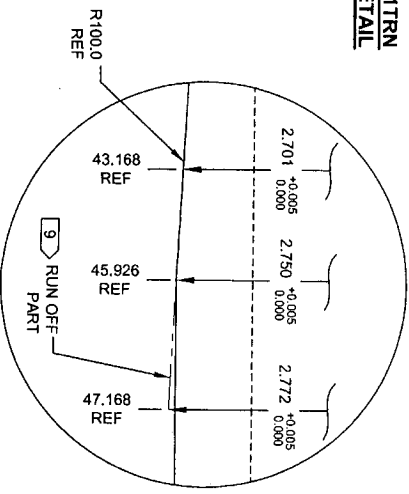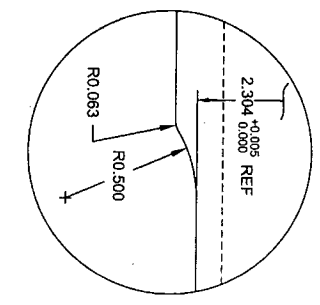

DESIGN	TH	DART AEROSPACE LTD
DRAWN	RF	HANESBURY, ONTARIO, CANADA
CHECKED	QD	DRAWING NO.
MFG. APPR	QD	D212-664-141
APPROVED	QD	REV. D
DE APPR	QD	SHEET 4 OF 4
DATE	09.09.30	XTUBE ASSY (205/12/412 HI FWD)
		SCALE
		NTS

THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE TO THE PUBLIC WITHOUT LIMITATION. IT IS THE PROPERTY OF DART AEROSPACE LTD. AND IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, INCLUDING PHOTOCOPYING, RECORDING, OR BY ANY INFORMATION STORAGE AND RETRIEVAL SYSTEM. WITHOUT PERMISSION IN WRITING FROM DART AEROSPACE LTD.

UNDER REVIEW
11.06.13

RELEASED
R 2009-10-29

DEO ATTACHED

93997

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

14/06.13
12 00511-614
11.07.28

93997

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		


IS:

WAS:


UNDER REVIEW

9/11/06.13

ECN# 11-614
11.07.28

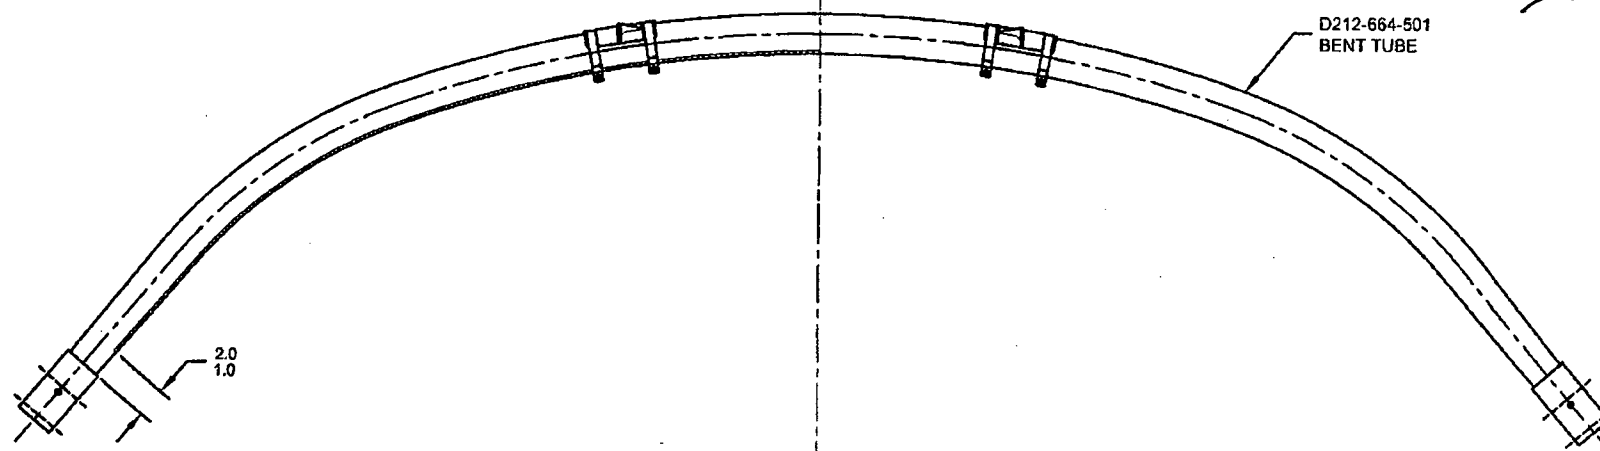

**D212-664-141/-141B
ASSEMBLY DETAIL**

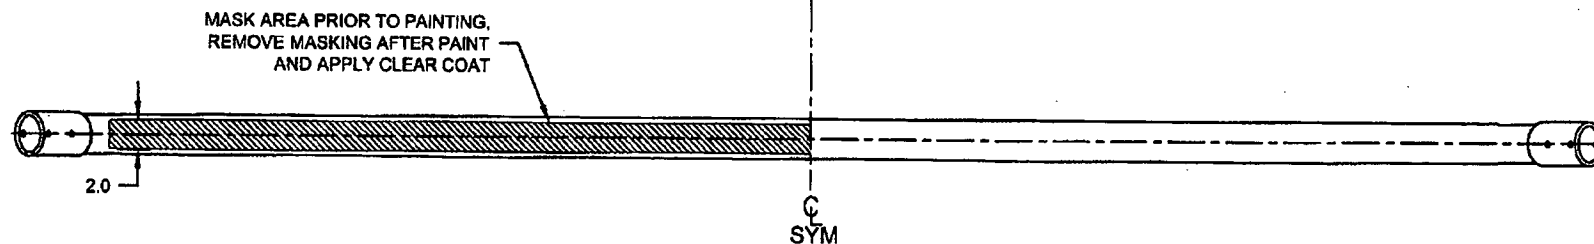

93997

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>MP</i>		DE APPR. <i>HH</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:


IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
Wm

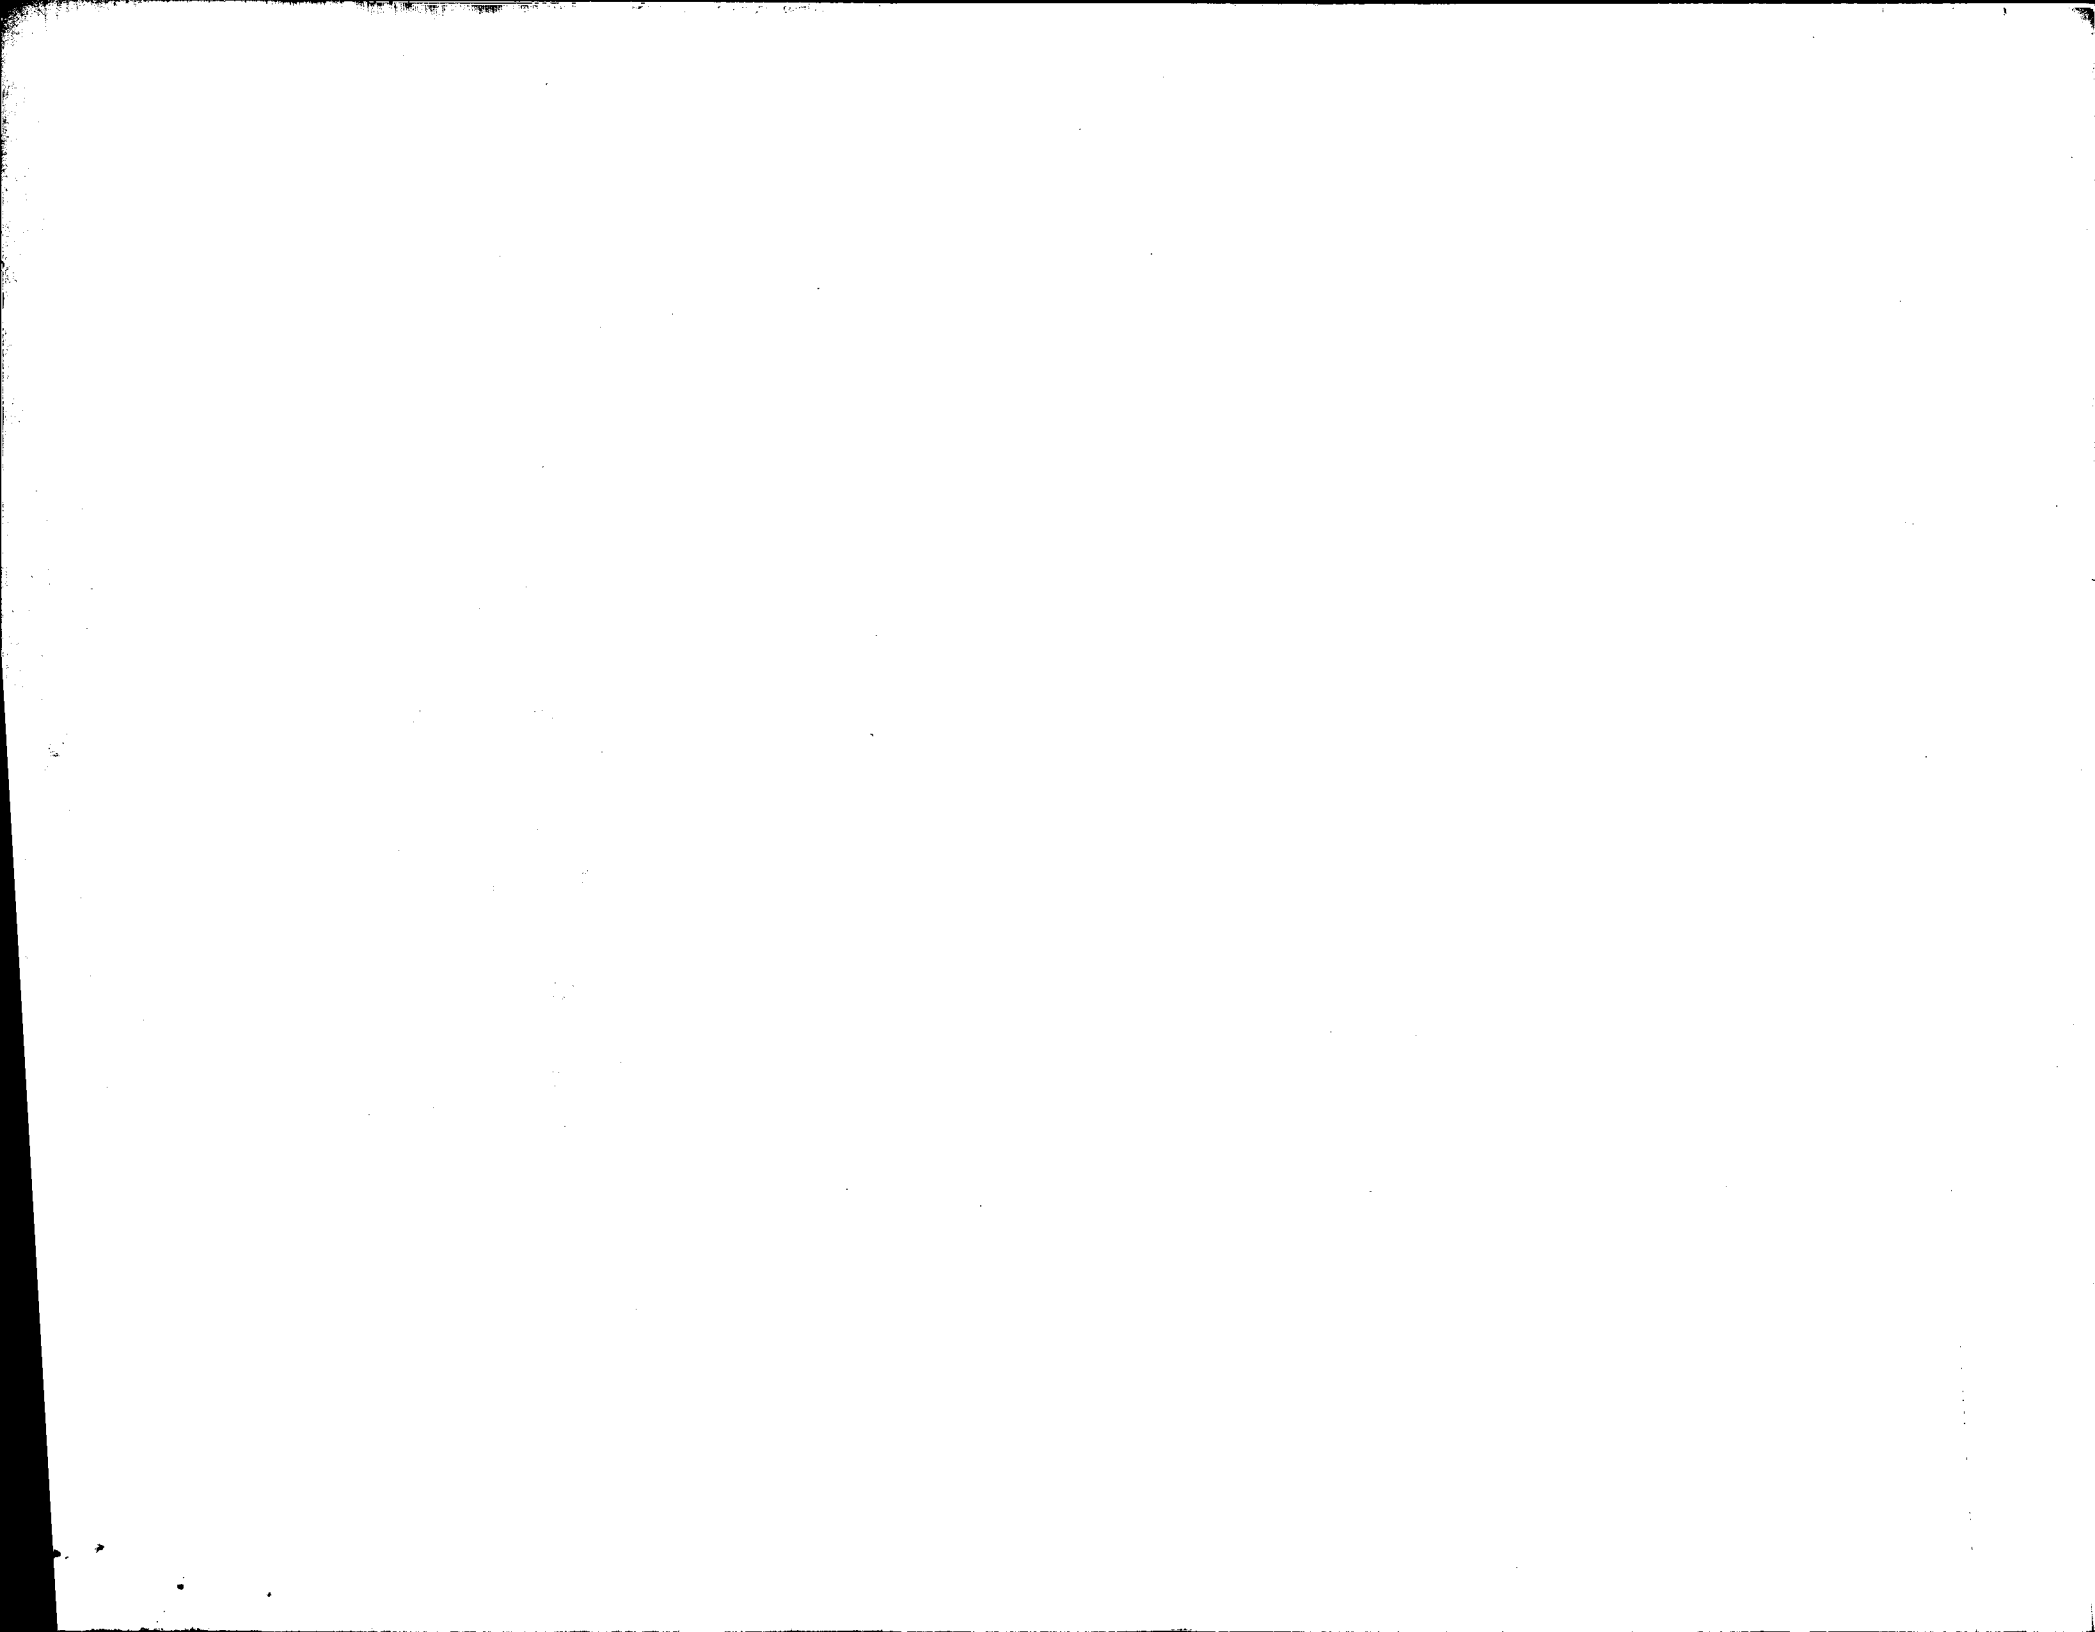

93997

DRAWING NO. D212-664-141		TITLE XTUBE ASSY (205/212/412 HI FWD)		REV. D DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-3		SHEET NO. SHEET 1 OF 1		SCALE NTS	
DRAWN AJS		CHECKED 9P		MFG. APPR. 140		APPROVED 140		DE APPR. 140			
DATE 12.06.28		DATE 12.07.05		DATE 12.07.05		DATE 12.07.05		DATE 12.07.05			

PURPOSE:

ADD NEW CONFIGURATION WITH ANODIZED FINISH

ADD -141F CONFIGURATION TO PARTS LIST AS SHOWN BELOW:

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
3	1	1	1	D6005-128	CROSSTUBE
4	2	2	2	D2893-1	SUPPORT
5	4	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

*NOTE ITEM 7 HAS BEEN UPDATED IN ACCORDANCE WITH DEO D212-664-141-D-2

AMEND NOTE 2 AS FOLLOWS:

IS:

- 2) FINISH -141 & -141B ONLY: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT

- FINISH -141F: a) ANODIZE PER MIL-A-8625. TYPE II. CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT

***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN
NOT TO CONTAMINATE OR DAMAGE FINISHED SURACES.

WAS: (UPDATED PER DEO D212-664-141-D-1)

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN IN DEO D212-664-141-D-1
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

RELEASED
2012-07-10
9P

